

CL-S521

Recommended Spare Parts List

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

PARTS LIST for CL-S521

TITLE: Recommended Spare Parts List

Sheet No. 1/1

Rev. No. 0

Item No.	Location	Part No.	Part Name	Q'ty/ Unit	Maint. Class		Remarks	@
					Worm	Casual		
1	2-5	JM66707-0	SA, Main PCB	1		○		
2	2-14	JM66850-0	Unit, Power Supply (100V)	1		○	For CSA	
3	2-14	JM66855-0	Unit, Power Supply (200V)	1		○	For CSE	
4	3-5	JM22701-0	SA, Platen	1	○			
5	3-10	JM66715-1	SA, Head Up Sensor PCB	1		○		
6	4-5	JM14705-0	SA, Head	1	○			
7	5-1	JM25704-0	SA, Motor	1	○			
8	5-14	JM66730-1	SA, Reflective Sensor PCB	1		○		
9	6-9	JM66725-0	SA, Transparent Sensor PCB	1		○		
10								
11								
12								
13								
14								
15								
16								
17								
18								
19								
20								


CL-S521

Drawing No. 1

Parts List & Location for General Assembly

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

DRAWING NO. 1 General Assembly (Rev. 0)

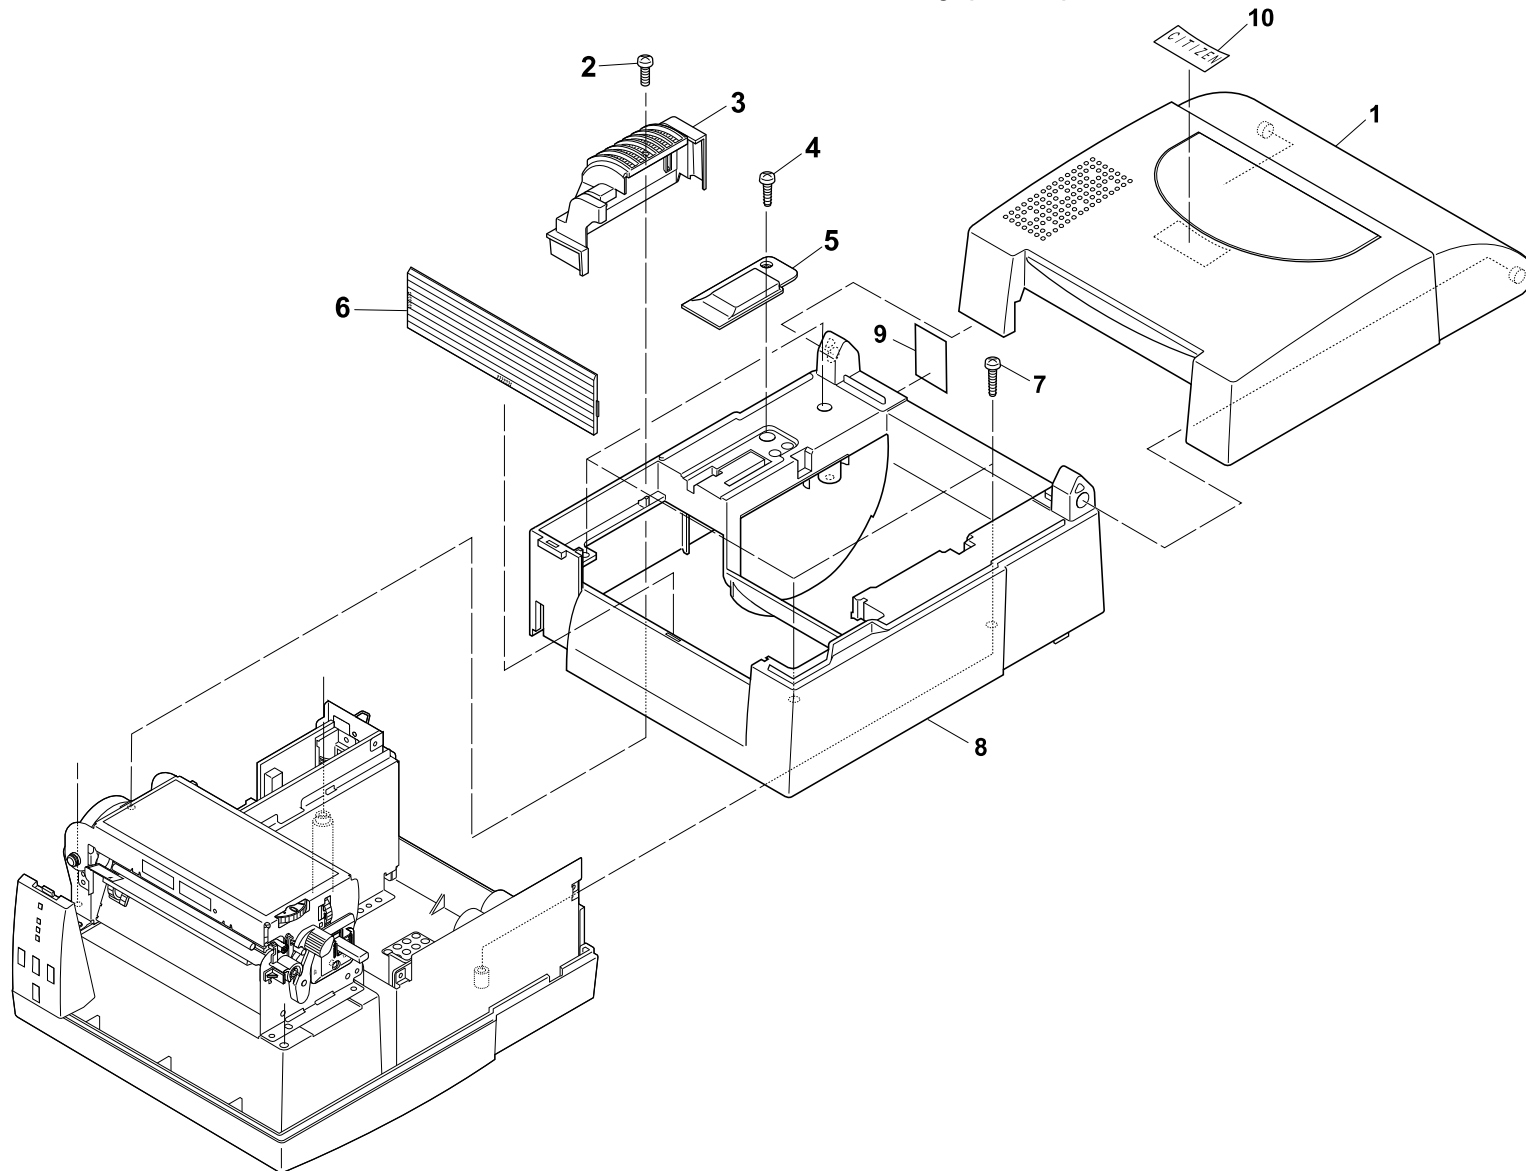

PARTS LIST for CL-S521

TITLE: General Assembly

Sheet No. 1/1

Drawing No. 1

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
1-1	SA, Top Cover Base	JM56723-0	1	White	
-1	SA, Top Cover Base	JM56740-0	1	Black	
-2	Screw, PH, M3.0x6	E00130-060F	1		
-3	Cover, Motor	JM56210-0	1	White	
-3	Cover, Motor	JM56247-0	1	Black	
-4	Screw, PHT (PT), M3.0X8	E10130-080F	1		
-5	Cover, Connector	JM56205-0	1		
-6	Cover, Front	JM56206-0	1	White	
-6	Cover, Front	JM56245-0	1	Black	
-7	Screw, PHT (PT), M3.0X14	E10130-140F	4		
-8	Case U	JM56202-2	1	White	
-8	Case U	JM56240-0	1	Black	
-9	Label, FCC ICES VCCI-A	TZ99901-0	1	For CSA	
-10	Label, CL-S521	JM99957-0	1		


CL-S521

Drawing No. 2

Parts List & Location for Base Unit

Revision Up List		
Sheet No.	Rev. No.	Date
1/2	0	Jun. 11, 2010
2/2	0	Jun. 11, 2010

DRAWING NO. 2 Base Unit (Rev. 0)

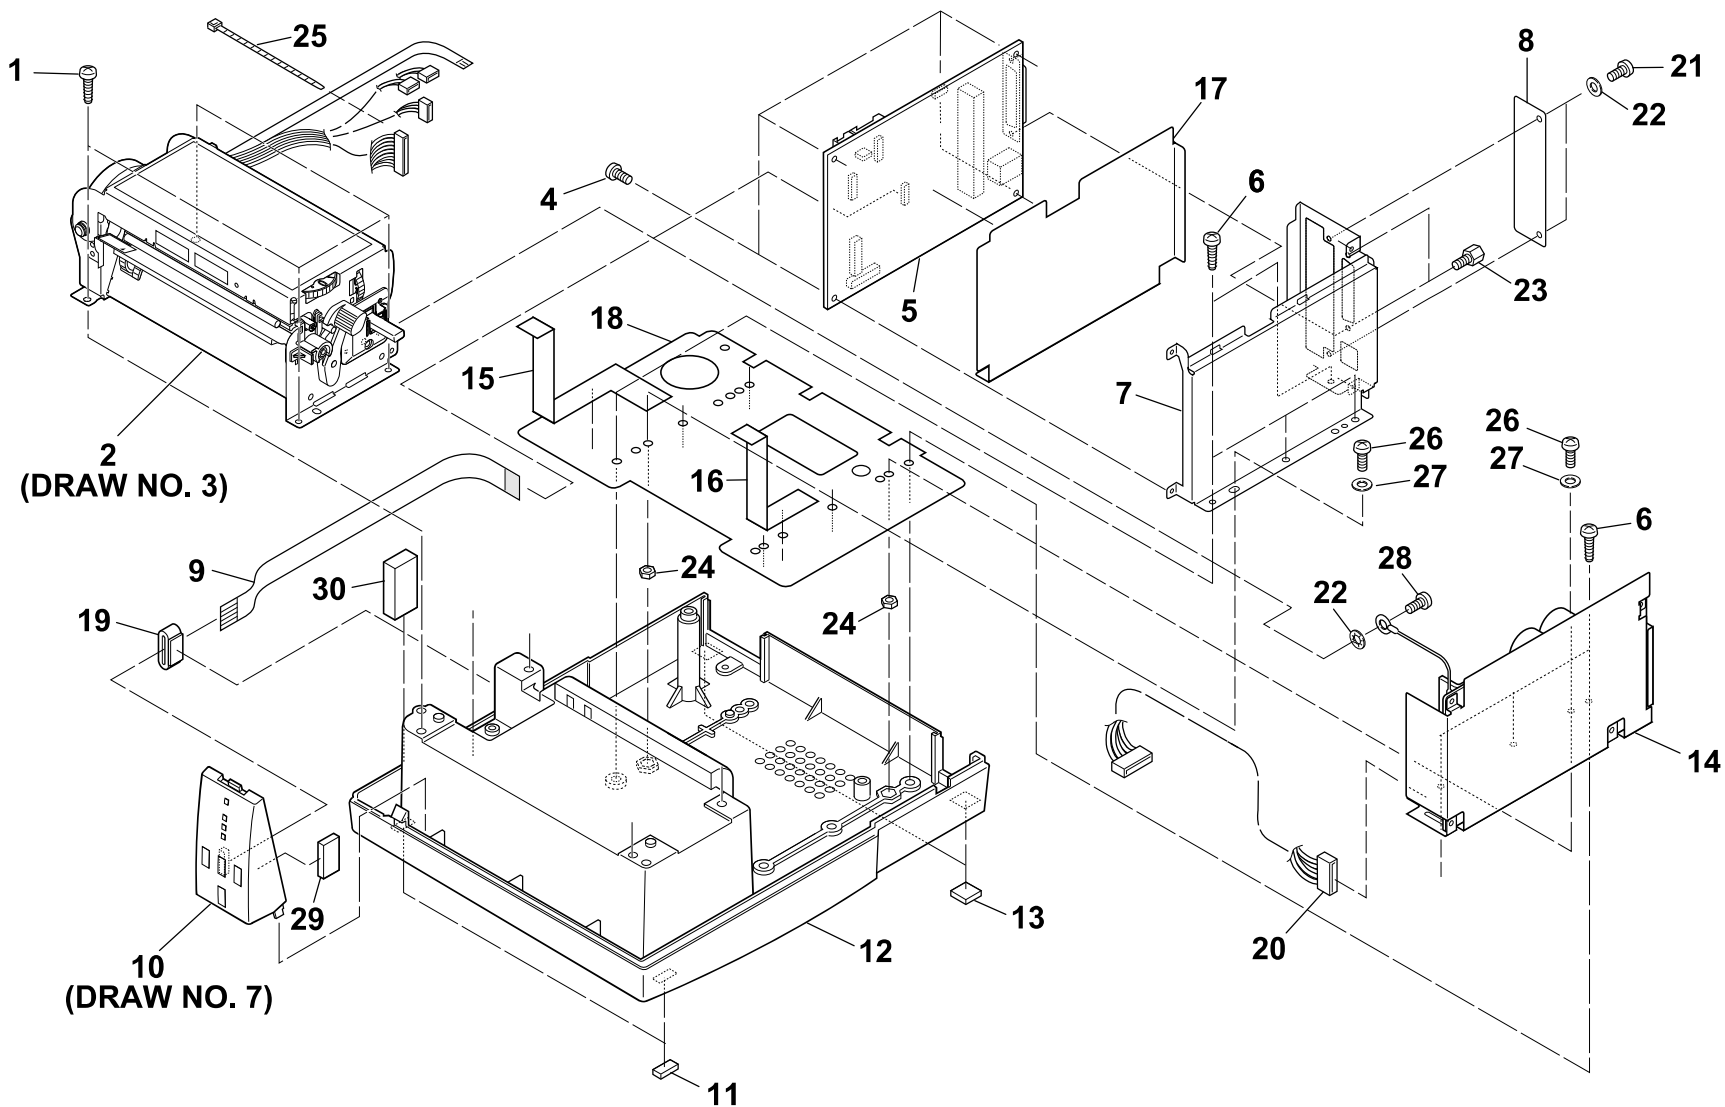

PARTS LIST for CL-S521

TITLE: Base Unit

Sheet No. 1/2

Drawing No. 2

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
2-1	Screw, PHT (PT), M3.0X14	E10130-140F	4	Ref. Drawing No. 3	
-2	Unit, Mechanism	JM49813-0	1		
-3	-	-	-		
-4	Screw, PHT (ST#3), M3.0X5	E11130-050F	4		
-5	SA, Main PCB	JM66707-0	1		
-6	Screw, PHT (PT), M3.0X8	E10130-080F	7		
-7	Plate, Main PCB	JM44103-0	1		
-8	Plate, Parallel IF Cover	JN54109-0	1		
-9	Cable, Ope-Pane	JM67900-1	1		
-10	Unit, Control Panel	JM56805-0	1	White Ref. Drawing No. 7	
-10	Unit, Control Panel	JM56808-0	1	Black Ref. Drawing No. 7	
-11	Leg, Case L F	JM59902-0	2		
-12	Case L	JM56201-0	1	White	
-12	Case L	JM56239-0	1	Black	
-13	Leg, Case L R	JM59901-0	2		
-14	Unit, Power Supply (100V)	JM66850-0	1	For CSA	
-14	Unit, Power Supply (200V)	JM66855-0	1	For CSE	
-15	Sheet, Earth L	JM44115-0	1		
-16	Sheet, Earth R	JM44114-0	1		
-17	Sheet, Main PCB	JM44116-0	1		

PARTS LIST for CL-S521

TITLE: Base Unit

Sheet No. 2/2

Drawing No. 2

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
2-18	Plate, Earth	JM54101-0	1	HFS-4S-B1W	
-19	SA, Core	JM59701-0	1		
-20	SA, Power Cable	JM67745-1	1		
-21	Screw, BHT (ST), M3.0X5	E14030-050WF	2		
-22	Washer, EXT.T, 3	E50730-000WF	3		
-23	Lock Screw (Inch)	C6390-049#	2		
-24	Nut, M4	E40140-000F	2		
-25	Wire Tie	C6701-202#	1		
-26	Screw, BH, M4.0X4	E00540-040WF	2		
-27	Washer, EXT.T, 4	E50740-000WF	2		
-28	Screw, BH(N), M3.0X6	E00530-060WF	1	8432 L=100	
-29	Cushion, Ope-pane Cable	JM59903-0	1		
-30	Cushion, Ope-pane Cover	JM59904-0	1		


CL-S521

Drawing No. 3

Parts List & Location for Unit, Mechanism

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

DRAWING NO. 3 Unit, Mechanism (Rev. 0)

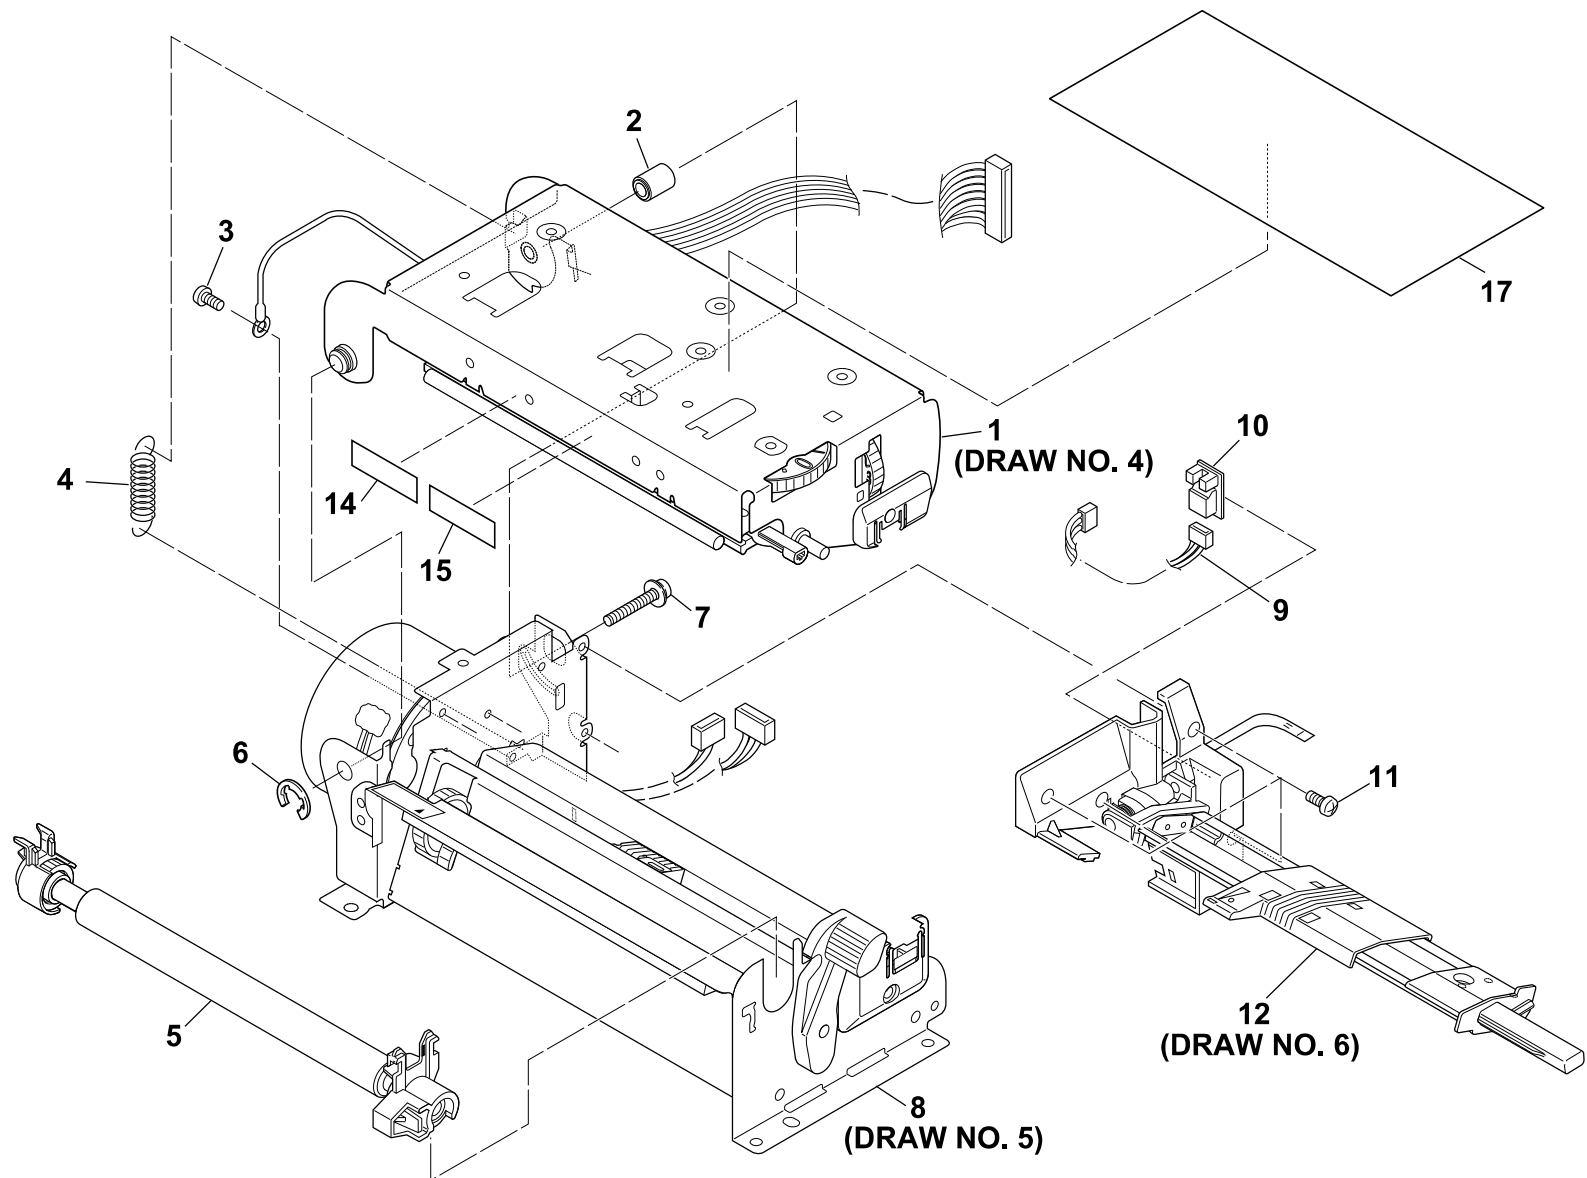

PARTS LIST for CL-S521

TITLE: Unit, Mechanism

Sheet No. 1/1

Drawing No. 3

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
3-1	Unit, Head-DT	JM19804-0	1	Ref. Drawing No. 4	
-2	Shaft, Head Holder	JM42007-0	1		
-3	Screw, PH, M3.0X6	E00130-060F	1		
-4	Spring, Head Up	JM13601-0	1		
-5	SA, Platen	JM22701-0	1		
-6	E-Ring, 4.0	E60340-000F	1		
-7	Screw, PH (SW+PW), M4.0X16	E00940-160F	1		
-8	Unit, PF	JM49814-0	1	Ref. Drawing No. 5	
-9	SA, Head Up Sensor Cable	JM67715-1	1		
-10	SA, Head Up Sensor PCB	JM66715-1	1		
-11	Screw, PH, M2.0X4	E00120-040F	4		
-12	Unit, Sensor U	JM29701-0	1	Ref. Drawing No. 6	
-	-	-	-		
-14	Label 2, Caution Head	AH90935-0	1		
-15	Label 7, Caution Head	AR99902-0	1	For CSA	
-15	Label 6, Caution Head	AR99901-0	1	For CSE	
-16	-	-			
-17	Sheet, Head Holder	JM19204-0	1		


CL-S521

Drawing No. 4

Parts List & Location for Unit, Head-DT

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

DRAWING NO. 4 Unit, Head-DT (Rev. 0)

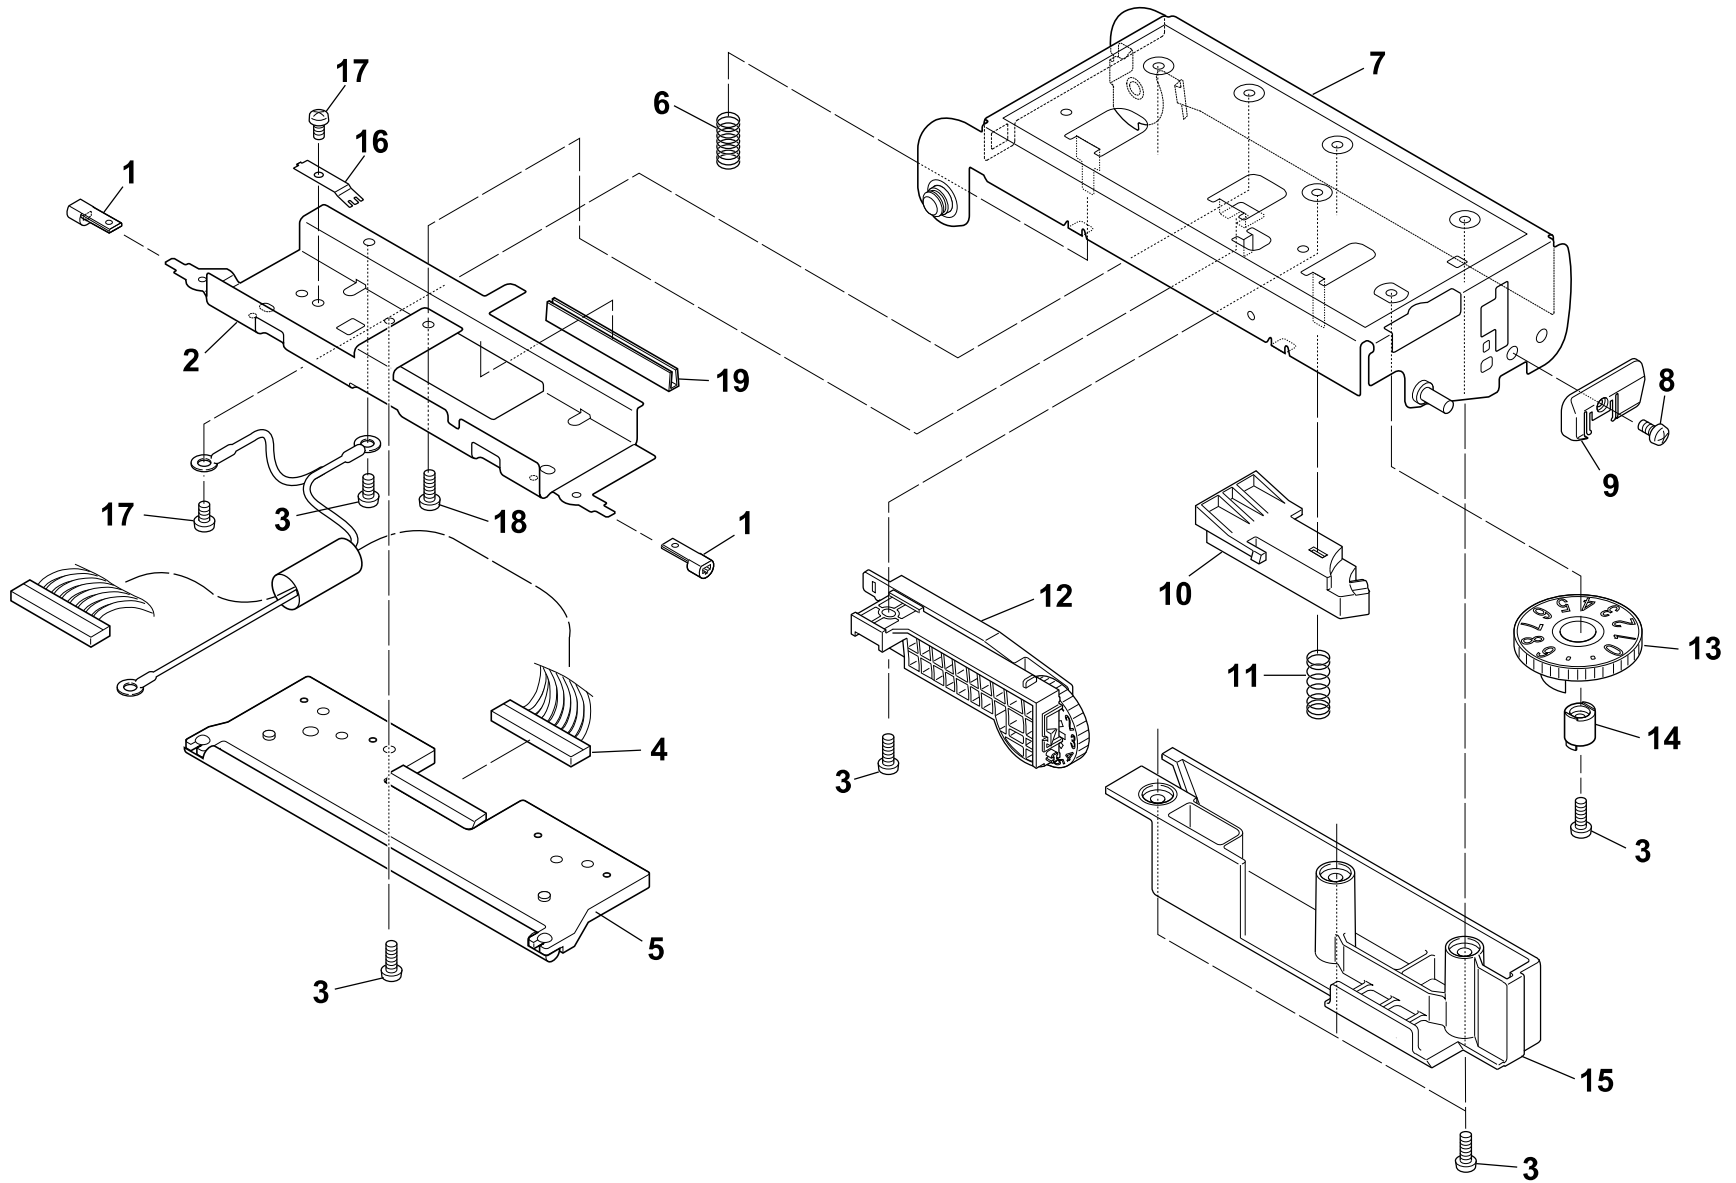

PARTS LIST for CL-S521

TITLE: Unit, Head-DT

Sheet No. 1/1

Drawing No. 4

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
4-1	Bushing, Head	JM11201-0	2		
-2	Bracket, Head	JM14101-0	1		
-3	Screw, PH, M3.0X6	E00130-060F	7		
-4	SA, Head Cable	JM67711-1	1		
-5	SA, Head	JM14705-0	1		
-6	Spring, Head L	JM13603-0	1		
-7	SA, Head Holder	JM14715-0	1		
-8	Screw, PHT(ST#3), M3.0X5	E11130-050F	1		
-9	Holder, Guide Sensor U	JM14208-0	1		
-10	Lever, Head Balance	JM14203-0	1		
-11	Spring, Head R	JM13602-0	1		
-12	SA, Head Adjust	JM14720-0	1		
-13	Cam, Head Balance	JM19203-0	1		
-14	Pivot, Head Balance Cam	JM12201-0	1		
-15	Guide, Head Cable	JM14210-0	1		
-16	Plate, Head Earth	JM14105-0	1		
-17	Screw, PH, M3.0X3	E00130-030F	2		
-18	Screw, PH, M3.0X8	E00130-080F	1		
-19	Guide, Head Connector	JM19902-0	1		


CL-S521

Drawing No. 5

Parts List & Location for Unit, PF

Revision Up List		
Sheet No.	Rev. No.	Date
1/2	0	Jun. 11, 2010
2/2	0	Jun. 11, 2010

DRAWING NO. 5 Unit, PF (Rev. 0)

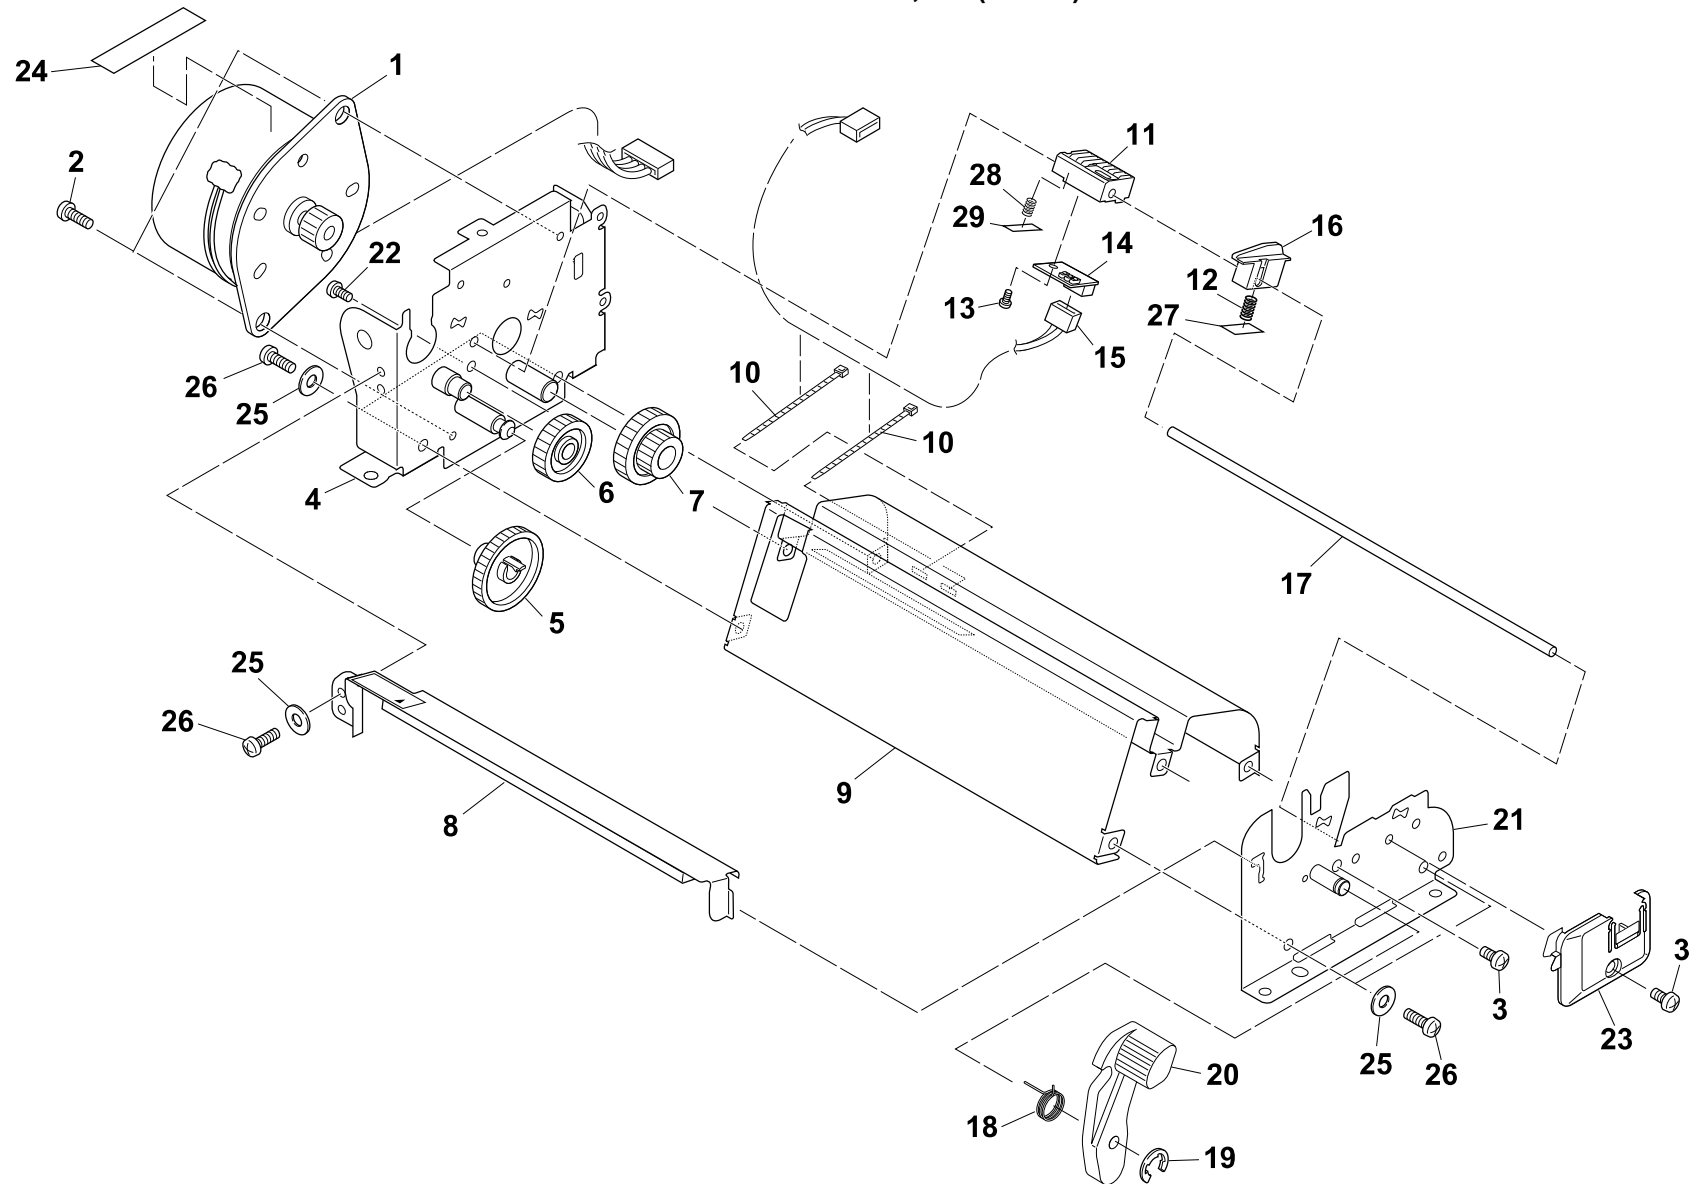

PARTS LIST for CL-S521

TITLE: Unit, PF

Sheet No. 1/2

Drawing No. 5

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
5-1	SA, Motor	JM25704-0	1	8432 L=100	
-2	Screw, PH, M3.0X3	E00130-030F	2		
-3	Screw, PH, M3.0X6	E00130-060F	2		
-4	SA, Main Plate L	JM44711-0	1		
-5	Gear, PF2	JM20202-0	1		
-6	Gear, PF Idle	JM20203-0	1		
-7	Gear, PF1	JM20201-0	1		
-8	SA, Plate Peeler	JM44709-0	1		
-9	Frame, Main	JM44101-0	1		
-10	Wire Tie	C6701-202#	2		
-11	SA, Sensor Holder L	JM24701-0	1		
-12	Spring, Friction PG	JM23604-0	1		
-13	Screw, No.0 PHT (BT#1), M2.0X3	E11920-030F	1		
-14	SA, Reflective Sensor PCB	JM66730-1	1		
-15	SA, Reflective Sensor Cable	JM67720-1	1		
-16	Guide, Paper Set	JM44202-2	1		
-17	Shaft, Sensor Guide	JM42008-0	1		
-18	Spring, Head Lock	JM43601-0	1		
-19	E-Ring,2.5	E60325-000F	1		
-20	Lever, Head Lock	JM44203-0	1		

PARTS LIST for CL-S521

TITLE: Unit, PF

Sheet No. 2/2

Drawing No. 5

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
5-21	SA, Main Plate R	JM44702-0	1		
-22	Screw, NO.0, PH (#1), M2.6X6	E01626-060F	1		
-23	Holder, Guide Sensor L	JM44207-0	1		
-24	Label 5, Caution Head	AK99925-0	1		
-25	Washer, EXT.T, 3	E50730-000WF	5		
-26	Screw, BH(N), M3.0X6	E00530-060WF	5		
-27	Plate, Friction PG	JM24117-0	1		
-28	Spring, Friction SEN L	JM23603-0	1		
-29	Plate, Friction SEN L	JM24116-0	1		


CL-S521

Drawing No. 6

Parts List & Location for Unit, Sensor U

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

DRAWING NO. 6 Unit, Sensor U (Rev. 0)

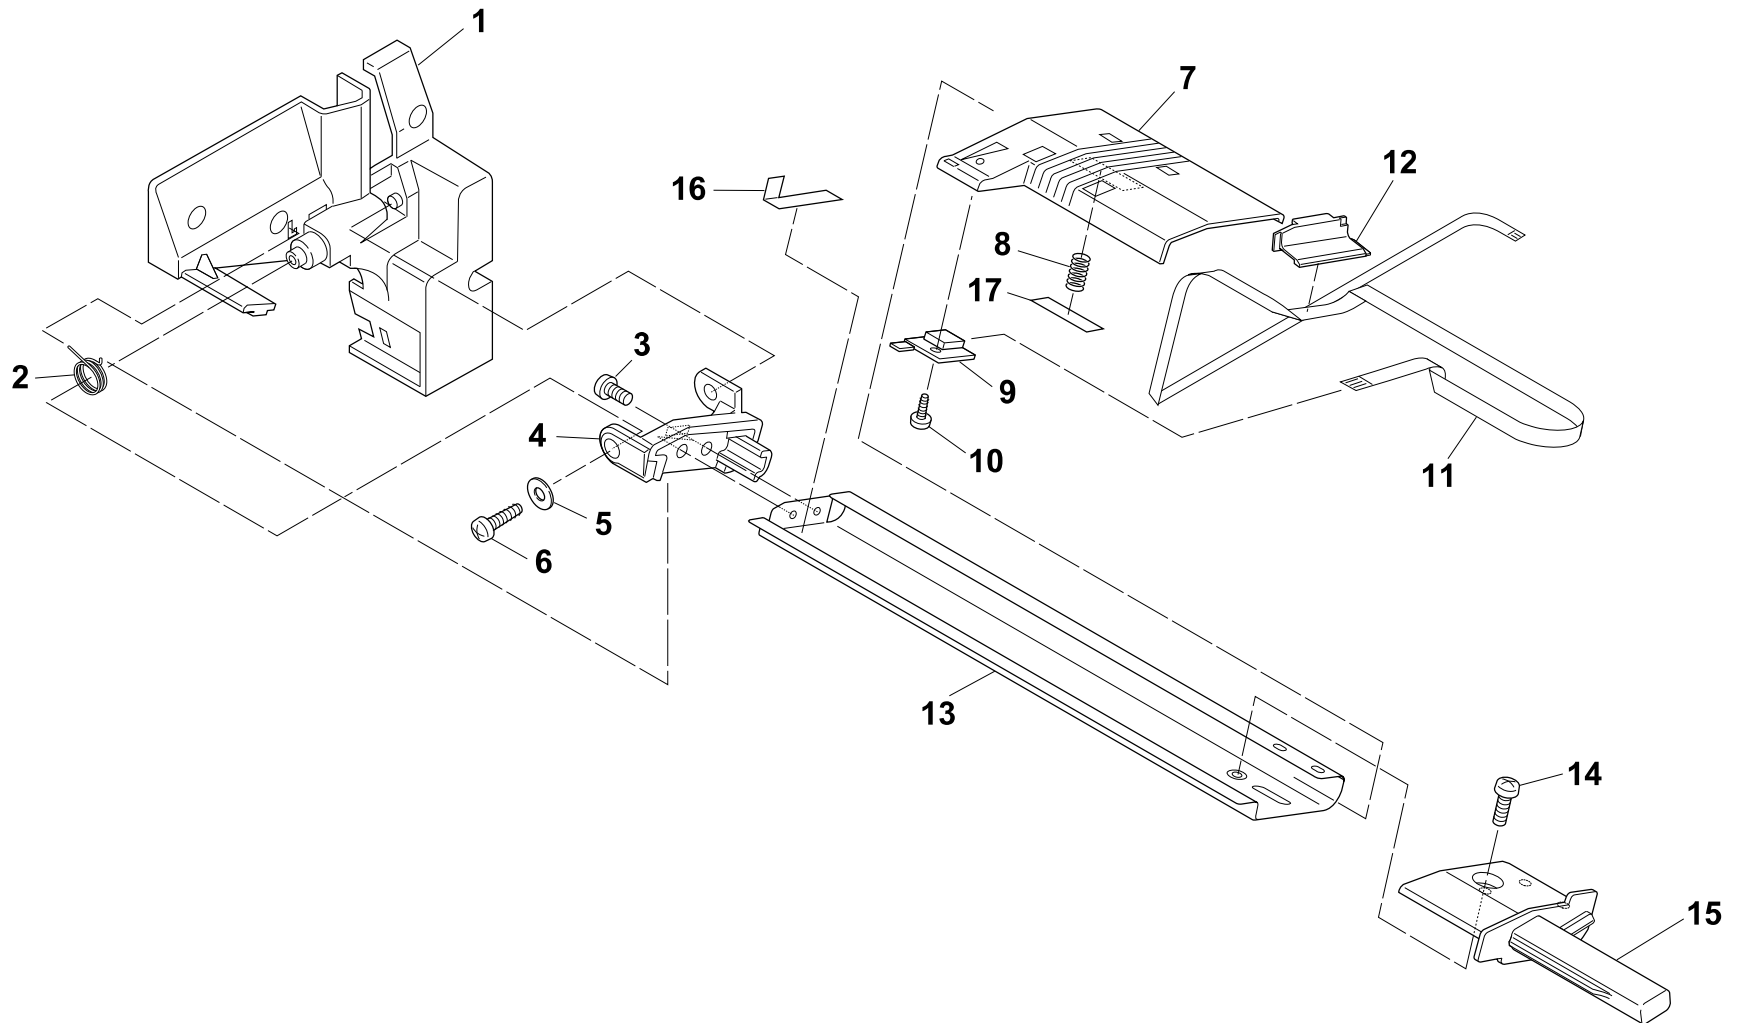

PARTS LIST for CL-S521

TITLE: Unit, Sensor U

Sheet No. 1/1

Drawing No. 6

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
6-1	Cover, Head Wire	JM44201-2	1		
-2	Spring, Sensor Frame	JM23602-0	1		
-3	Screw, PH, M2.6X3	E00126-030F	2		
-4	Cap, Sensor Frame L	JM24210-0	1		
-5	Washer, Plain, 2	E50120-003F	1		
-6	Screw, PHT(PT), M2.0X8	E10120-080F	1		
-7	Holder, Sensor U	JM24205-3	1		
-8	Spring, Friction SEN U	JM23605-0	1		
-9	SA, Transparent Sensor PCB	JM66725-0	1		
-10	Screw, No.0 PHT (BT#1), M2.0X3	E11920-030F	1		
-11	SA, Transparent Sensor Cable	JM67705-1	1		
-12	Cap, Sensor Cable U	JM24212-0	1		
-13	Frame, Sensor Holder U	JM24150-0	1		
-14	Screw, PH, M3.0X6	E00130-060F	1		
-15	Cap, Sensor Frame R	JM24211-0	1		
-16	Tape, Sensor Cable U	JM24105-2	1		
-17	Plate, Friction SEN U	JM24118-0	1		


CL-S521

Drawing No. 7

Parts List & Location for Unit, Control Panel

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

DRAWING NO. 7 Unit, Control Panel (Rev. 0)

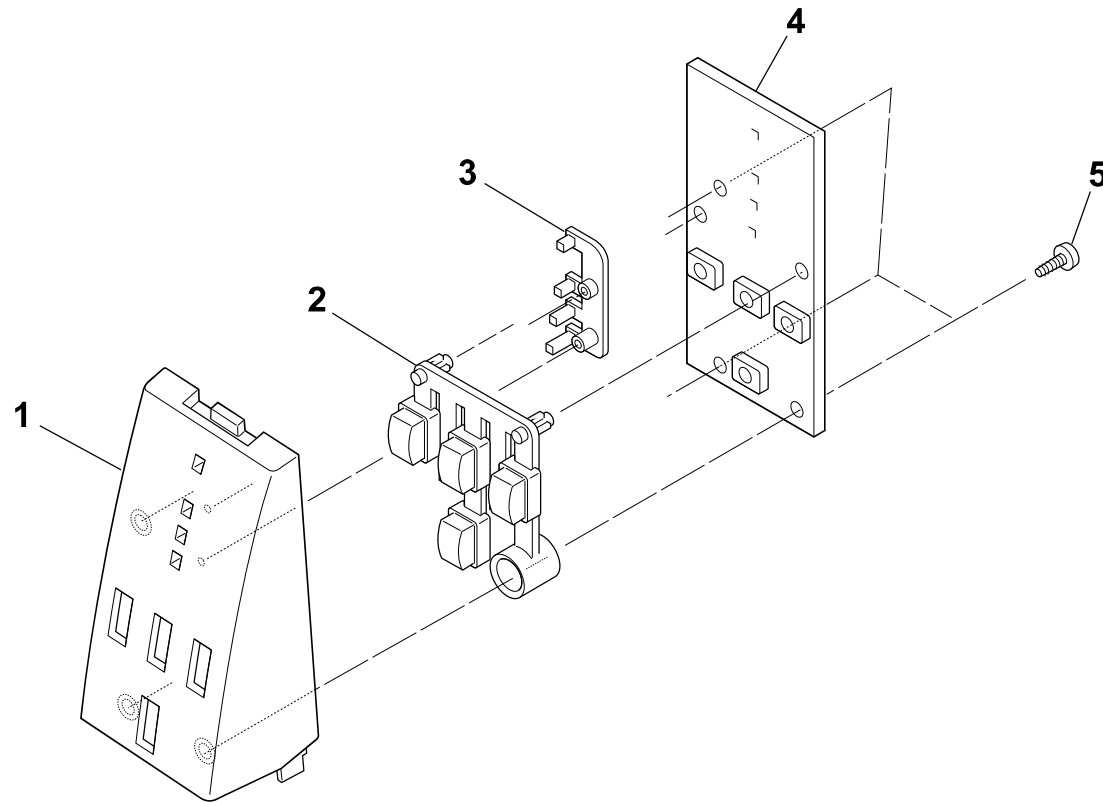

PARTS LIST for CL-S521

TITLE: Unit, Control Panel

Sheet No. 1/1

Drawing No. 7

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
7-1	Cover, Ope-Pane	JM56204-0	1	White	
-1	Cover, Ope-Pane	JM56242-0	1	Black	
-2	Switch, Key	JM56253-0	1		
-3	LED, Window	JM56208-0	1		
-4	SA, Ope-Pane PCB	JM66720-1	1		
-5	Screw, PH, M3.0X6	E00130-060F	3		


CL-S521

Drawing No. 8

Parts List & Location for Accessories

Revision Up List		
Sheet No.	Rev. No.	Date
1/1	0	Jun. 11, 2010

DRAWING NO. 8 Accessories (Rev. 0)

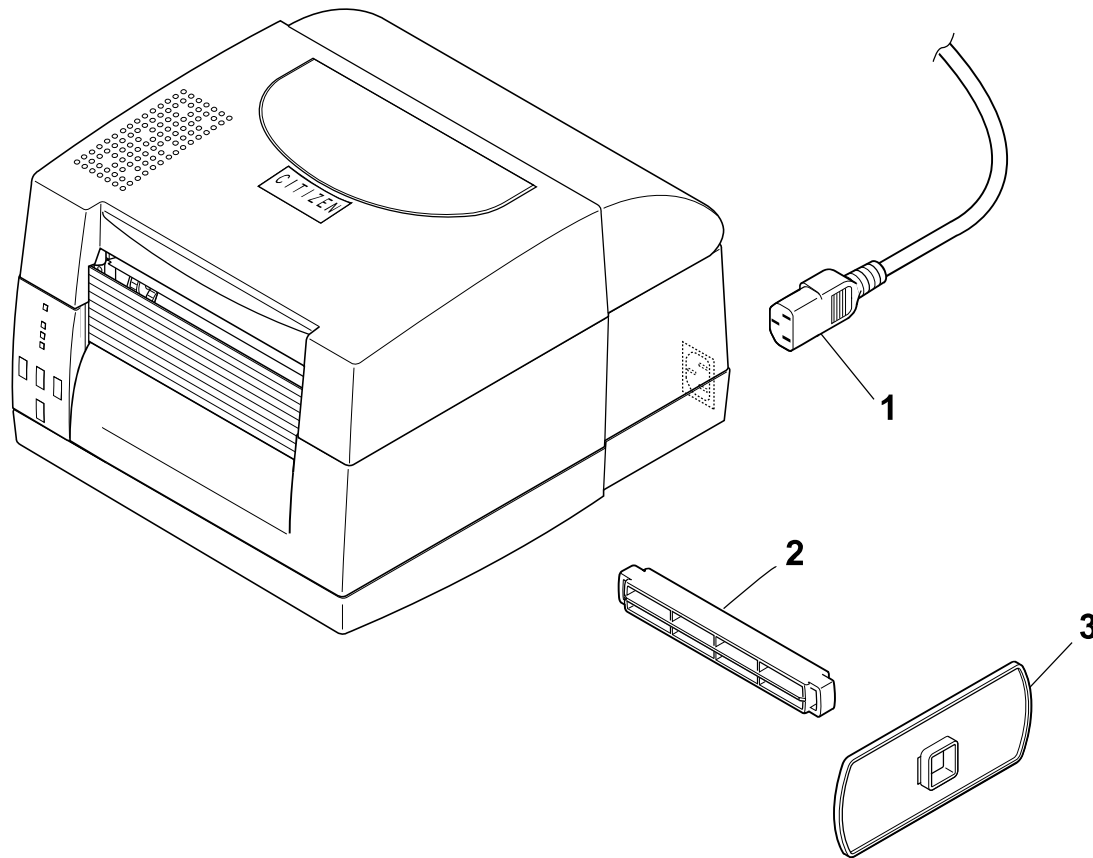

PARTS LIST for CL-S521

TITLE: Accessories

Sheet No. 1/1

Drawing No. 8

Rev. No. 0

Location	Part Name	Part No.	Q'ty/ Unit	Remarks	@
8-1	Cord Set (UL/CSA)	C6009-000#	1	For CSA	
-1	Cord Set (OE Straight)	C6009-200#	1	For CSE	
-1	Cord SET (UK)	C6009-300#	1	For CSE	
-2	Shaft, Paper	JM79202-0	1		
-3	Flange, Paper Wide	JM79201-0	1		
-	Cleaner, Head	JM79904-0	1		
-	Manual, User's (CD-R)	JN74924-2	1		
-	Guide, Quick-Start	JM74981-0	1		
-	Label, Paper (ACCESSORY)	JN79902-0	1		